


## NEW

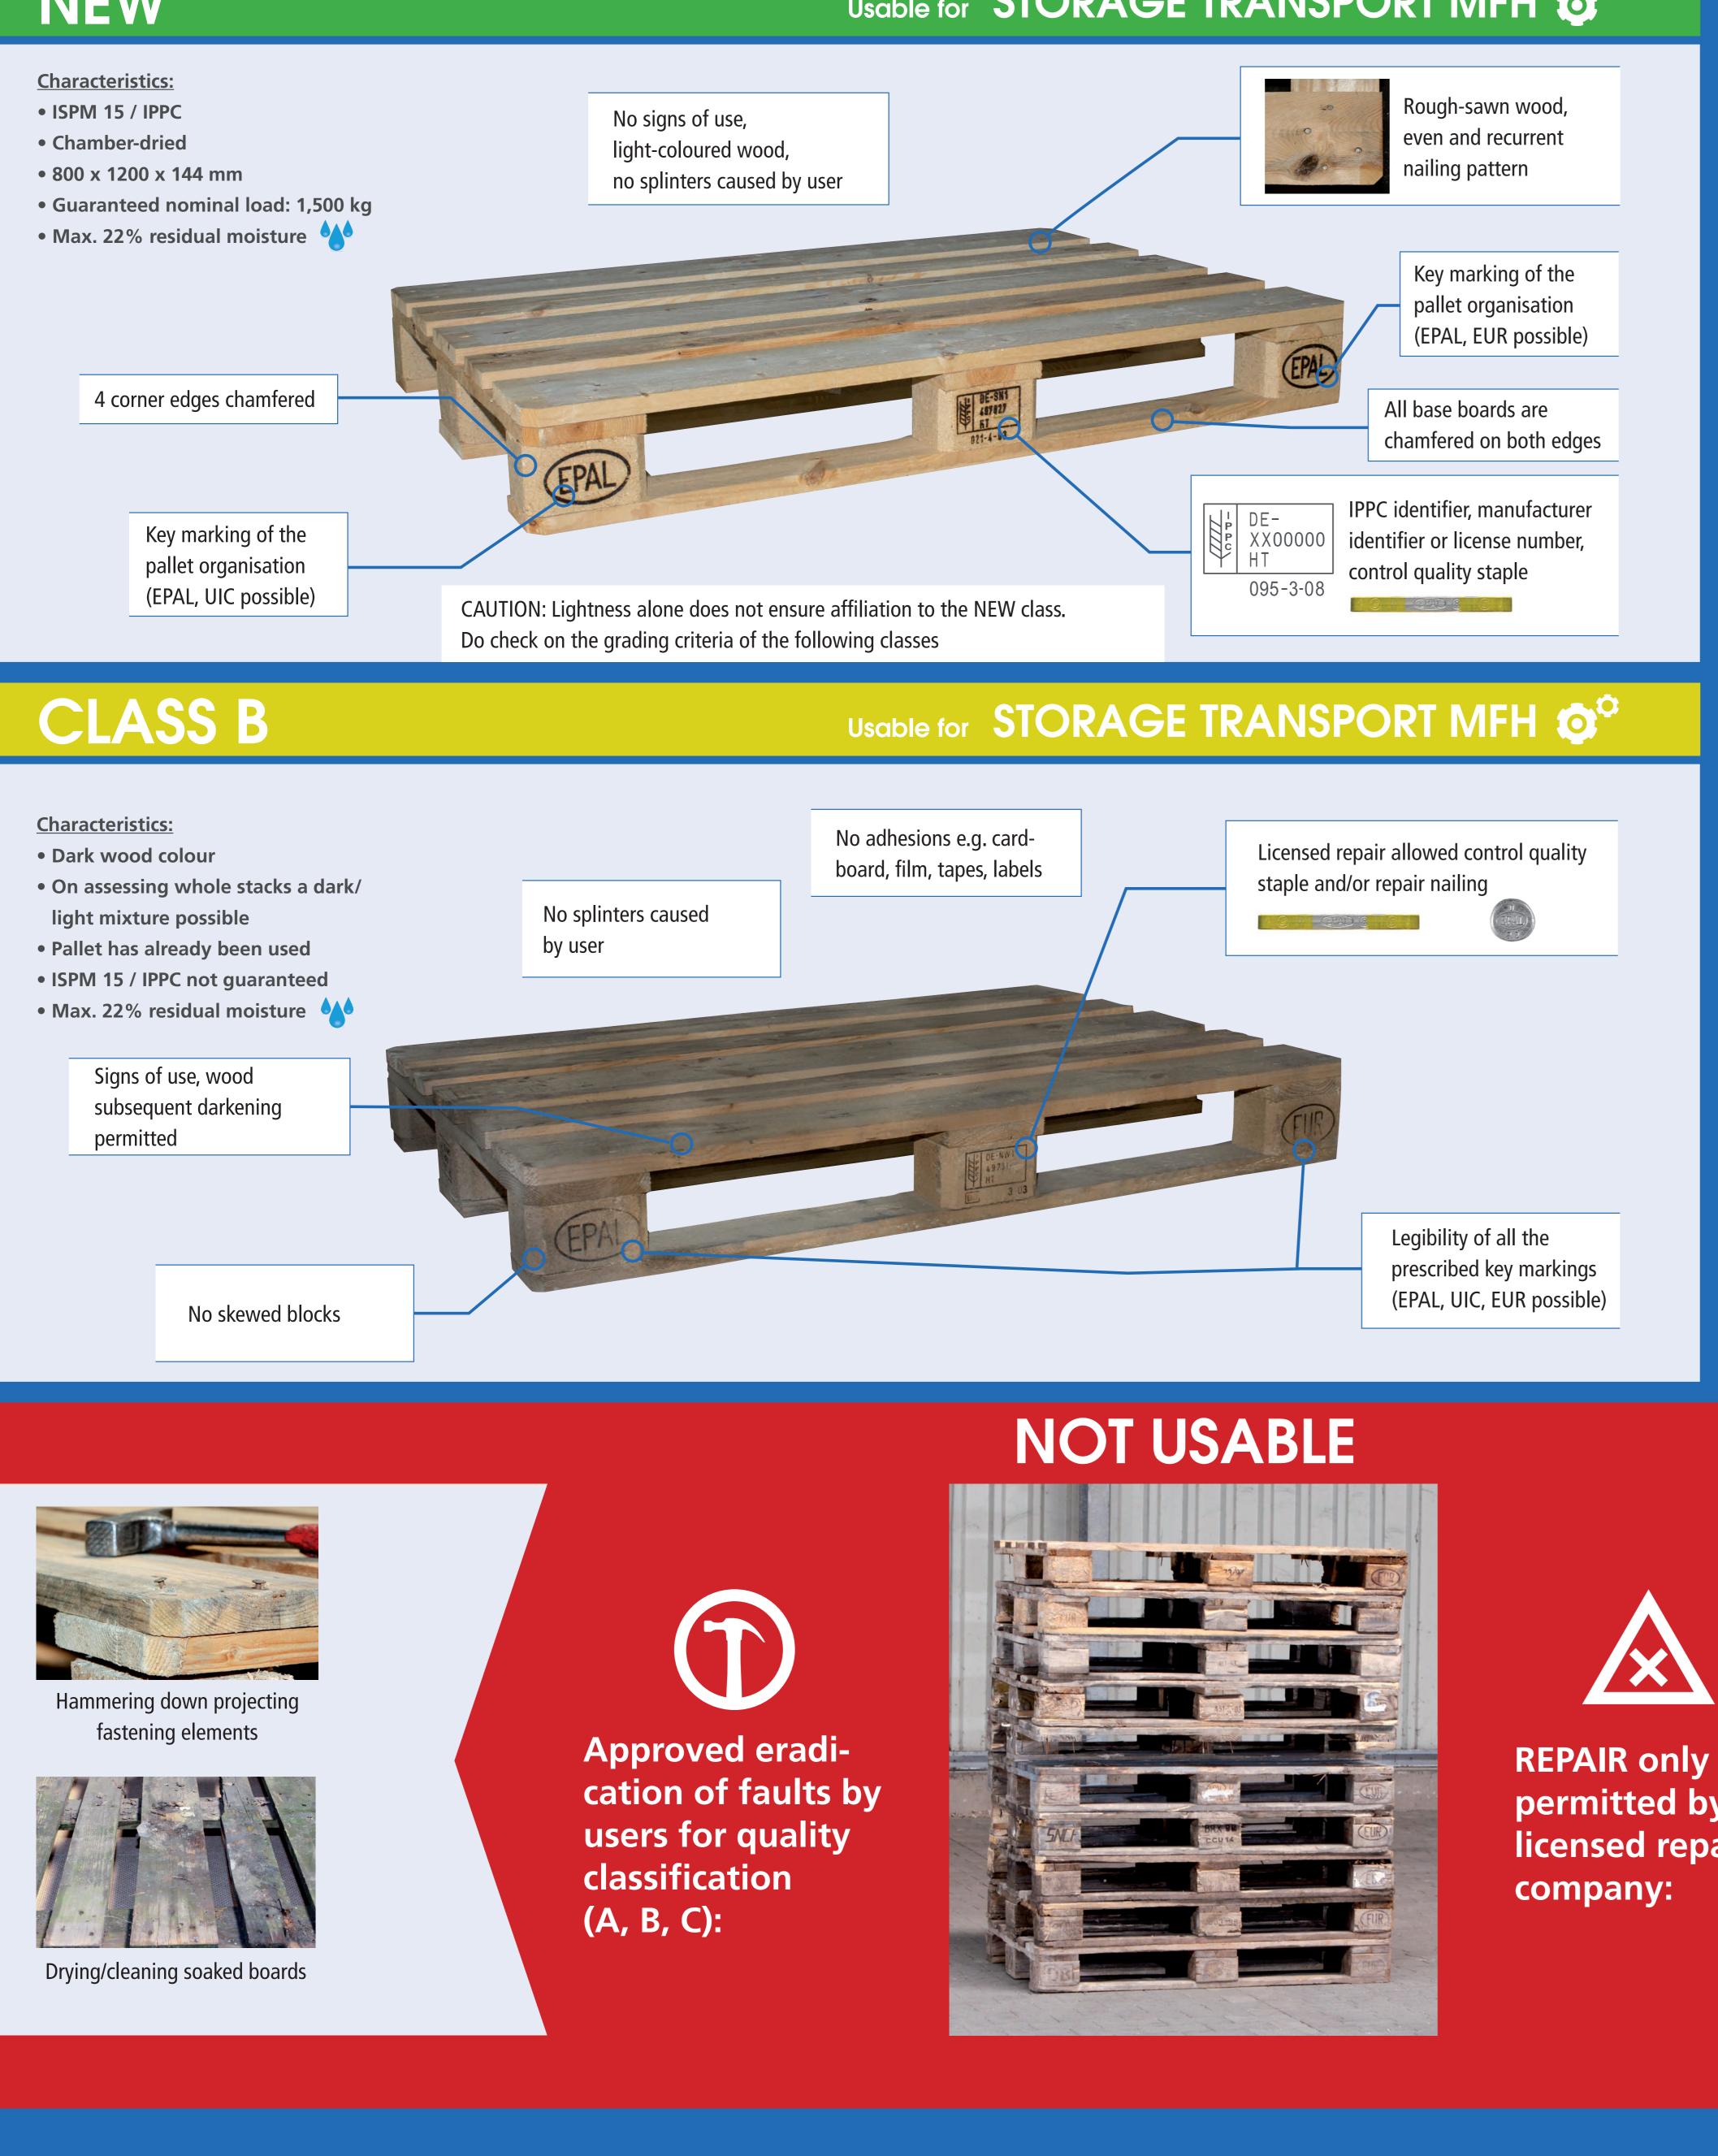

#### Contact

**GS1 Germany GmbH** · Maarweg 133 · 50825 Köln · Phone: +49 (0) 221 94714 - 0 · Fax: +49 (0) 221 94714 - 990 · info@gs1-germany.de · www.gs1-germany.de European Pallet Association e.V. · Wahlerstraße 28 · D-40472 Düsseldorf · Phone: +49 (0) 211 98 480 48 - 0 · Fax: +49 (0) 211 98 480 48 - 48 · info@epal-pallets.org · www.epal.eu

# QUALITY CLASSIFICATION For the open pallet exchange pool

## Usable for STORAGE TRANSPORT MFH 0


permitted by duly licensed repair

# **CLASS A**



- ISPM 15 / IPPC not guaranteed


by user

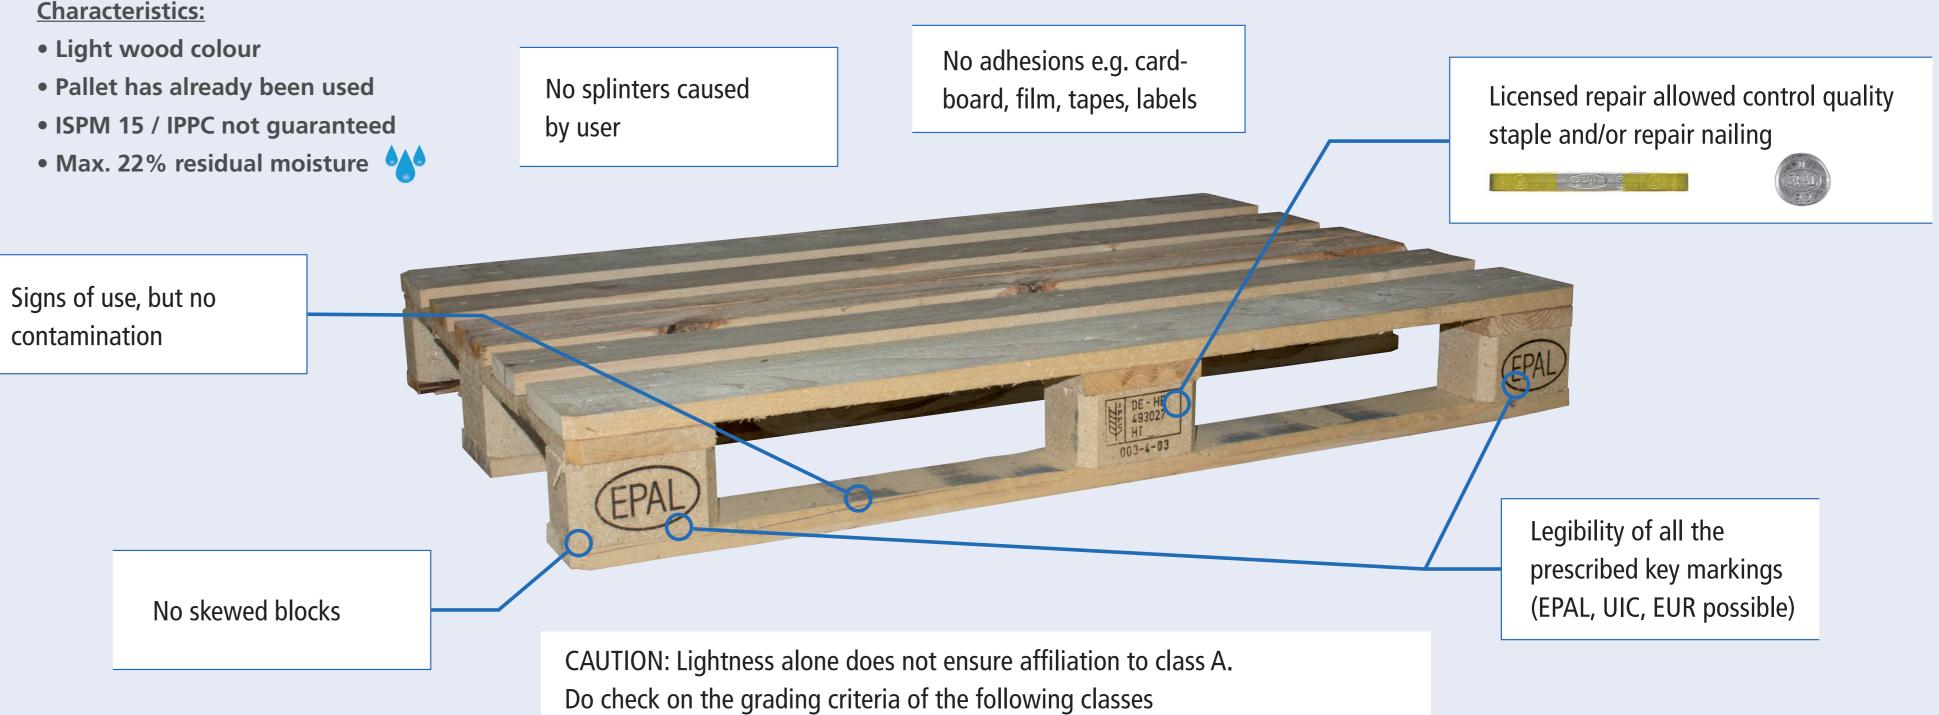

# CLASS C

**Characteristics:** 

- Pallet has already been used
- ISPM 15 / IPPC not guaranteed

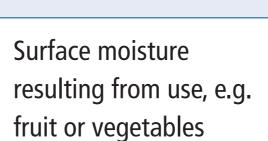

Signs of use, wood

subsequent darkening permitted



Slightly skewed blocks,  $(\leq 1 \text{ cm of overhang})$ 



Adhesions permitted e.g. cardboard, film, tapes, labels Higher classification possible once removed

CAUTION: A max. 1 nail shank per construction element, a maximum total of 2 nail shanks visible at the pallet the tips of which are not visible or exposed

#### Without being repaired, pallets with these faults must not be used in the open pallet exchange pool



Missing component



Visible fastening elements e.g. nails



Inadmissible component e.g. underdimensioned, woodwormeaten, wane



Contaminations which can be passed onto the products e.g. paint, oil, smell, mould, mould stains etc.









### Usable for STORAGE TRANSPORT MFH 0

## Usable for **STORAGE TRANSPORT**

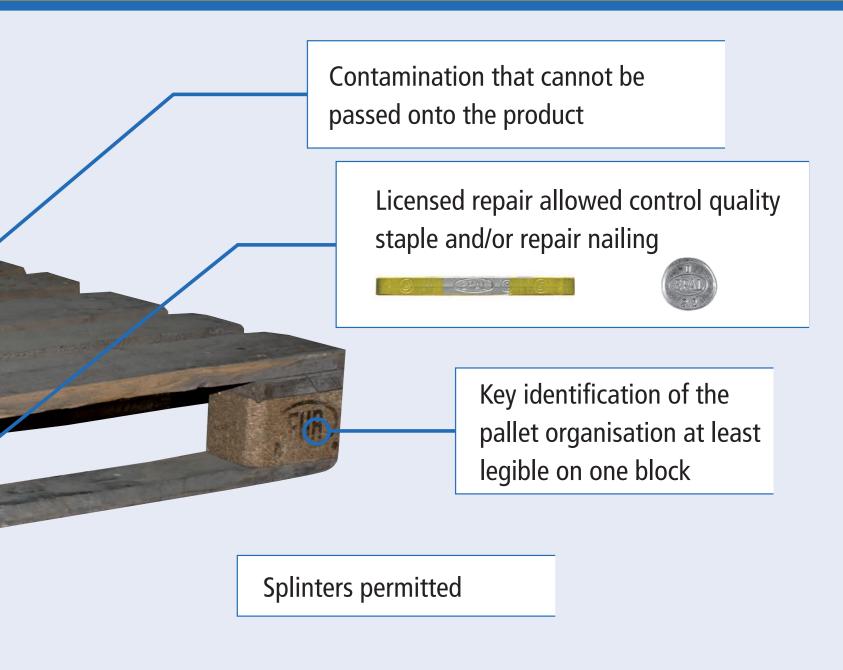



Inadmissible repair

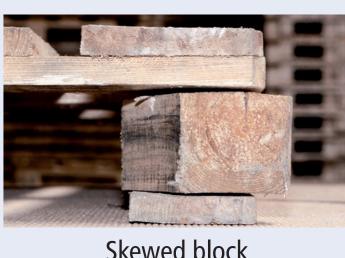

Skewed block > 1 cm



No longer any prescribed identification legible